


NOTE: DIAGRAM ABOVE SHOWS HOW ONE HIVE CAN BE CUT FROM A 1x12 AND A 1x8, BOTH 10' LONG, AND A 2x2 6' LONG. (1/8" FOR SAW CUT)

MEANING OF SYMBOLS	
B	BOTTOM
T	TOP
-E	END
-S	SIDE
B-	BROOD BODY
S-	SHALLOW SUPER

EXPLODED TOP: T-1, T-2, THE TWO T-3'S, T-4, AND THE TWO T-5 PIECES ARE ASSEMBLED TO FORM THE TOP.

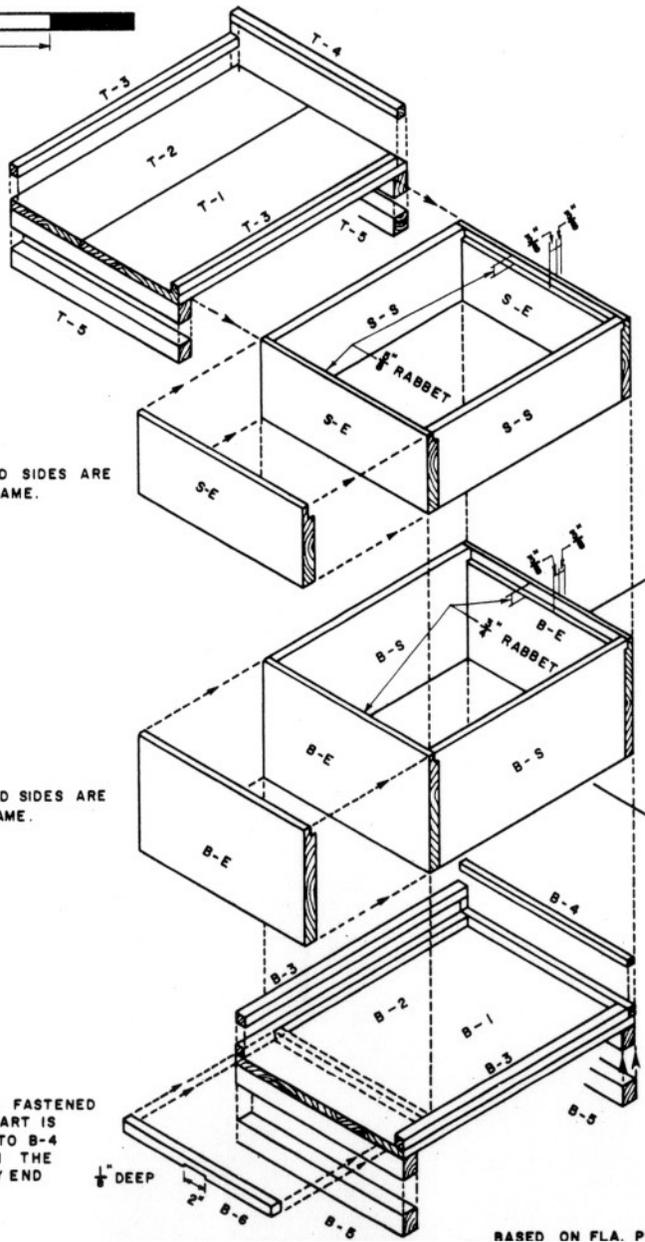


SHALLOW SUPER
EXPLODED END VIEW: ENDS AND SIDES ARE ASSEMBLED INTO ONE SOLID FRAME.


BROOD BODY
EXPLODED END VIEW: ENDS AND SIDES ARE ASSEMBLED INTO ONE SOLID FRAME.

EXPLODED BOTTOM: B-1 AND B-2 ARE FASTENED AT EACH END TO A B-5 PART. A B-3 PART IS ATTACHED TO EACH SIDE, BUTTING UP TO B-4 AT THE END. B-6 IS LOCATED BETWEEN THE B-3'S AND DIRECTLY BELOW BROOD BODY END AS SHOWN.

SCHEDULE OF PARTS		
SYMBOL	AMOUNT	DIMENSIONS (INCHES)
T-1	1	3/4 x 9 5/8 x 22 3/8
T-2	1	3/4 x 6 5/8 x 22 3/8
T-3	2	3/4 x 3/4 x 21 5/8
T-4	1	3/4 x 3/4 x 16 1/4
T-5	2	1 1/8 x 1 1/2 x 16 1/4
S-S	2	3/4 x 6 5/8 x 19 1/8
S-E	2	3/4 x 6 5/8 x 16 1/4
B-S	2	3/4 x 9 5/8 x 19 1/8
B-E	2	3/4 x 9 5/8 x 16 1/4
B-1	1	3/4 x 9 5/8 x 22 1/2
B-2	1	3/4 x 6 5/8 x 22 1/2
B-3	2	3/4 x 3/4 x 21 3/4
B-4	1	3/4 x 3/4 x 16 1/4
B-5	2	1 1/8 x 1 1/2 x 16 1/4
B-6	1	3/4 x 3/4 x 14 3/4

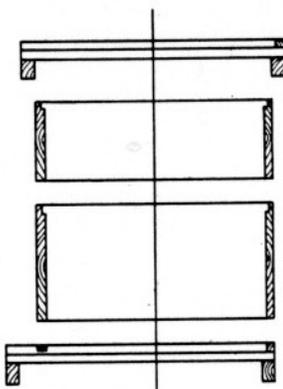

SECTION A

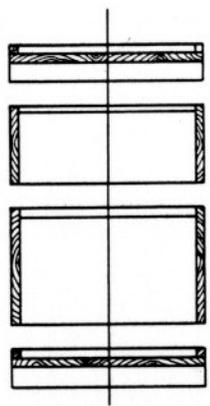

SECTION B



COOPERATIVE EXTENSION WORK IN
AGRICULTURE AND HOME ECONOMICS

AND
UNITED STATES DEPARTMENT OF AGRICULTURE COOPERATING

LOW COST BEEHIVE

USDA 180 EX. 6324 SHEET 1 OF 1